


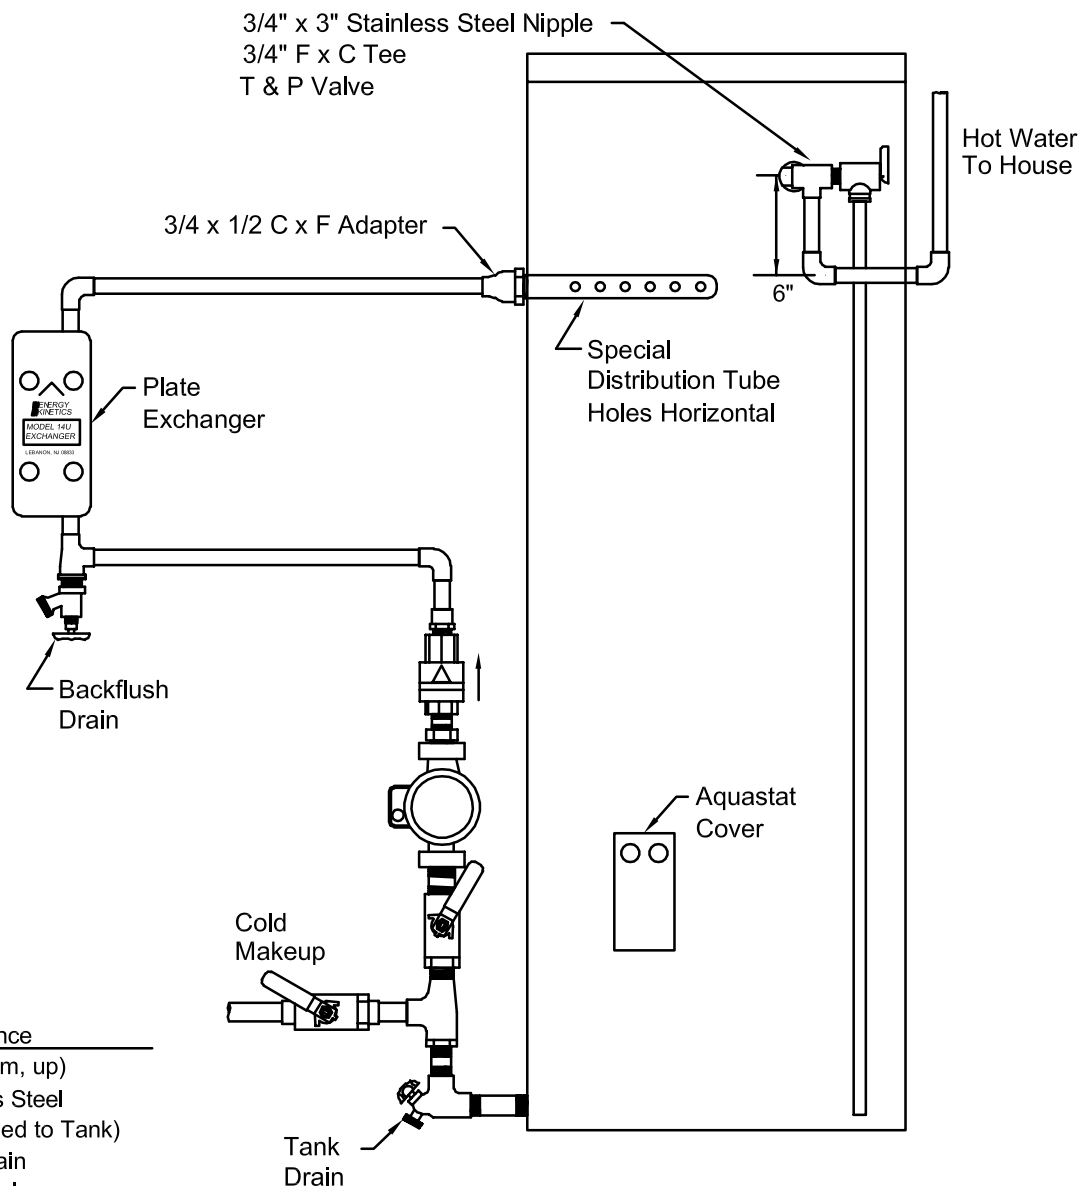

Fittings in Sequence

(From Tank bottom, up)

3/4 x 6 Stainless Steel Nipple (Welded to Tank)
 Combo Tee & Drain
 3/4 x 2 Brass Nipple
 3/4 M x F x C Tee
 3/4 Ball Valve
 3/4 x 2 Brass Nipple
 3/4 Bronze Circulator
 3/4 x 1/2 Bushing
 1/2 x 2 Brass Nipple
 1/2 Check Valve
 1/2 Male Adapter
 1/2 Copper Tubing
 1/2 Copper Ell
 1/2 Copper Tubing
 1/2 C x F x C Tee
 1/2 Boiler Drain

Assembly Notes

- 1.) Special distribution tube is welded in proper position.
- 2.) Use good grade thread sealant when connecting fittings to stainless tank connections. Check for leaks on startup.

SYSTEM 2000
ENERGY KINETICS
 Molasses Hill Road
 Lebanon, NJ 08833
 1-800-323-2066

Superstor Aquabank Piping
 40 Gallon Tank (19 X 52)

DRAWN BY: MDM	REV: A	DATE: 10/4/99
CAD FILENAME: sys-02-010-rev1.dwg		

DWG. NO.

SYS-02-010